


UNCLASSIFIED / NON CLASSIFIÉ

ANALYZED

| | | |
|---|---|---|
|  | National Research Council Canada | Conseil national de recherches Canada |
| | C.I.S.T.I. | I.C.I.S.T. |
| | Aeronautical and Mechanical Engineering Library | Bibliothèque d'aéronautique et de génie mécanique |

TO _____ DATE _____

Report no.: QCX - AVRO - CF105- P-WT-138

has been downgraded to : _____

de-classified

by (Name): Michel W. Drapeau

(Dept.): A/DND Coordinator, Access to Information

Date: Dec. 7, 1992

R. Auger
Signature



54885

12417488



UNCLASSIFIED

A. V. ROE CANADA LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT (Aircraft)

AIRCRAFT: ARROW

REPORT NO. P/WIND TUNNEL/138

UNCLASSIFIED / NON CLASSIFIÉ

FILE NO:

NO. OF SHEETS: _____

TITLE:

ARROW .07 SCALE LONG RANGE TANK JETTISON TESTS

SERIES I AND SERIES II

N.A.E. LOW SPEED WIND TUNNEL

August and November, 1956.

CONFIDENTIAL

Classification ~~cancelled / changed to:~~ ^{confirmed as} **UNCLASSIFIED**

By authority of: DRDA 7/DARET 5-8/DAS Eng 6-4-5

Date: 5 Nov 1992

Signature: B. Aubrey

Unit / Rank / Appointment: DS18 3, Secretary CRAD HQ DRP

PREPARED BY G. K. Dimock DATE Dec. 1957.

CHECKED BY G. K. Dimock DATE _____

SUPERVISED BY [Signature] DATE _____

APPROVED BY [Signature] DATE _____

| ISSUE No | REVISION No. | REVISED BY | APPROVED BY | DATE | REMARKS |
|----------|--------------|------------|-------------|------|---------------------|
| | | | | | UNCLASSIFIED |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

~~CONFIDENTIAL~~
UNCLASSIFIED

REPORT No. P/Wind Tunnel/138

SHEET No. _____

AIRCRAFT:

ARROW

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

UNCLASSIFIED / NON CLASSIFIÉ

SUMMARY

Low speed wind tunnel jettison tests using dynamic scale models have been completed for the long range fuel tank installation on the Arrow for level flight conditions. Several tank configurations were checked in two series of tests. The full scale Mach number range simulated was .2 to .85; the full scale altitudes simulated were sea level, 20,000 feet; and 40,000 feet.

Satisfactory jettison characteristics were obtained for a tank configuration with the "small" tail, -2° incidence to the fuselage datum, and a 5° release angle.

The jettison tests showed that the tanks can be jettisoned clear of the aircraft at all speeds and altitudes within the flight envelope of the tank for level flight conditions (with dive brakes closed). The initial pitching moment of the tanks resulted in the horizontal tail of the tanks (especially empty tanks) coming close to interfering with the fuselage, but there were no positive cases of contact. The full tanks generally fell straight down below the aircraft except at low altitudes when the aircraft was yawed, when they moved outboard. The empty tanks almost always moved outboard as they fell below the aircraft. A flight test programme for tank jettison tests was proposed on the basis of the test results.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ

REPORT No. P/Wind Tunnel/128

SHEET NO. _____

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

TABLE OF CONTENTS

| | Page |
|---|------|
| Summary | i |
| Table of Contents | ii |
| 1.0 Introduction | 1 |
| 2.0 Models | 2 |
| 2.1 Model Design | |
| 2.2 Description of Models | |
| 3.0 Description of Tests | 3 |
| 3.1 Tunnel Test Arrangement | |
| 3.2 Tunnel Operating Conditions | |
| 4.0 Test Programme | 5 |
| 4.1 Series I | |
| 4.2 Series II | |
| 5.0 Test Results - Series I | 6 |
| 5.1 Discussion | |
| 6.0 Test Results - Series II | 8 |
| 6.1 Discussion | |
| 6.2 Roll and Yaw Angles at Release | |
| 6.3 Tank - Missile Clearance | |
| 6.4 Model Trajectories | |
| 7.0 Proposed Flight Jettison Test Programme | 11 |
| 8.0 Conclusions | 12 |
| Appendix | |
| Tables | |
| Figures | |



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ
CONFIDENTIAL

REPORT NO. P/Wind Tunnel/138

SHEET NO. 1

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

1.0 INTRODUCTION

This report presents the results of two series of jettison tests which were performed using .07 scale dynamic models of the long range fuel tank. The dynamic models were jettisoned from their position underneath the fuselage of the .07 scale Arrow model in the 6 x 10 ft. Low Speed Wind Tunnel at the National Aeronautical Establishment, Ottawa.

The investigation was made to evaluate the proposed jettison arrangements with respect to tank-aircraft interference, and to determine the trajectories of tanks jettisoned from the aircraft for various level flight conditions.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ

REPORT NO. F/Wind Tunnel/138

SHEET NO. 2

| | | |
|-------------------------------|------------------------------|------------|
| AIRCRAFT: <u>ARROW</u> | UNCLASSIFIED / NON CLASSIFIÉ | |
| | PREPARED BY | DATE |
| | G.K. Dimock | Dec. 1957. |
| | CHECKED BY | DATE |
| | | |

2.0 MODELS

2.1 MODEL DESIGN

The dynamic scale models used in these tests were designed and manufactured by Avro Aircraft Limited. The design data, based on dynamic similarity at three altitudes is given in the Appendix to this report.

The model configurations used in the two series of tests are listed in Table 1. The various models were designated by letters painted on the sides of the tanks.

The models were constructed to scale using various combinations of different woods, metals and plastics to obtain the desired dynamic properties. The full tank models were made of solid impregnated mahogany with blocks of lead for ballast, and had aluminum tail surfaces. The tank empty models were constructed using balsa and birch centre-sections, and formed acetate sheet fore- and after- bodies. The tail surfaces were made from birch or balsa, and pieces of lead or aluminum were used for ballasting.

The actual and required inertia properties are compared in Table 2.

2.2 DESCRIPTION OF MODELS

The dimensional characteristics of the tank models are sketched in Figure 1. One of the series II models is shown in Figure 2. The tank models were fitted to the bottom of the fuselage by means of slotted release pins on the two forward struts, and an undercut swivel pin on the aft pylon. A spring-loaded slide located in the fuselage fitted into the slots of the forward pins, and the undercut part of the swivel pin fitted to a hole in a plate on the bottom of the fuselage above the aft pylon.

The forward pin (guide pin) on the aft pylon determined the release angle at which the model was dropped. When the release slide was operated the front struts fell free and the model pivoted about the swivel pin. As the model pitched nose down, the guide pin moved out of its slot and allowed the swivel pin to come clear of the fuselage.

For the series I tests the models rotated thru $7\frac{1}{2}^{\circ}$ from the initial incidence before being fully released. In series II, the release angle was reduced to 5° .

The forward struts were cambered to contribute a nose down load after the tank was released.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIED
CONFIDENTIAL

REPORT No. P/Wind Tunnel/138

SHEET No. 3

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIED

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

3.0 DESCRIPTION OF TESTS

3.1 TUNNEL TEST ARRANGEMENT

The .07 scale model of the Arrow I aircraft was mounted in the 6x10 ft. test section by means of a tail strut and twin wing struts. The tank models were fitted underneath the fuselage of the aircraft model. The drawing in Figure 3 shows the position of the tank as tested on the model.

Two photographs of the aircraft model with a tank model installed are given in Figure 4. The Bowden cable, which can be seen in these pictures, was connected to the release mechanism in the model fuselage and to a bicycle-type brake handle outside the test section. When the handle was pressed the release mechanism moved free of the slotted pins and the model pivoted until it fell free. The models come free as soon as the handle was pressed.

A catch-screen of chicken-wire was installed across the test section about 10 ft. behind the aircraft model. Cushions of rubberized packaging material were nailed to the tunnel floor in an attempt to protect the models from excessive damage.

Two Fastax high-speed cine-cameras were used to record each jettison test. One camera was placed on the tunnel floor at the entrance to the test section about 10 ft. from the aircraft model. The front camera was on the centre-line of the aircraft but was not lined up with the models when the aircraft model was yawed. In the series I tests the other camera was set up outside the test section on a line approximately 30° from the perpendicular to the longitudinal axis of the Arrow model, and slightly below the level of the tank models. For the series II tests the second camera was aligned along the perpendicular to the aircraft centre-line, but was inclined such that a three-quarter view of the bottom of the fuselage at the tank was obtained.

The film speed was set at about 750 frames per second for both test series. The Fastax timing unit operates from a 120 volt, 60 cycle a.c. supply which results in 120 timing marks on the film per second. The time between the beginning of one mark and the starting point of the next will be 0.00833 seconds.

At the beginning of a test run the cameras were started and allowed to run for about two seconds in order to reach the desired film speed before the photographic lighting system was switched on. The release handle was pressed just after the lights came on, and the cameras were stopped when the models hit the catch-screen.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIED
CONFIDENTIAL

REPORT NO. P/Wind Tunnel/138

SHEET NO. 4

| | | | |
|------------------------|------------------------------|-------------|------------|
| AIRCRAFT: ARROW | UNCLASSIFIED / NON CLASSIFIÉ | PREPARED BY | DATE |
| | | G.K. Dimock | Dec. 1957. |
| | | CHECKED BY | DATE |
| | | | |

The tank models were always checked for satisfactory wind off free fall before proceeding with a test run. Models that could not be made to fall satisfactorily, or that were too loose, were not used.

3.2 TUNNEL OPERATING CONDITIONS

The tunnel operating conditions are given in the Appendix. The basic parameter for tunnel operation is the indicated dynamic pressure.

$$q_{\text{dial}} = 1.069 q_{\text{true}}$$



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIED

REPORT No. P/Wind Tunnel/138

SHEET NO. 5

| | | | |
|---------------------------|------------------------------|-------------|------------|
| AIRCRAFT: <u>ARROW</u> | UNCLASSIFIED / NON CLASSIFIÉ | PREPARED BY | DATE |
| | | G.K. Dimock | Dec. 1957. |
| | | CHECKED BY | DATE |

4.0 TEST PROGRAMME

4.1 SERIES I

In test series 1, the tanks were released after about $7\frac{1}{2}^{\circ}$ rotation from the initial position.

Ten level flight conditions with the aircraft at zero yaw were simulated including:

- Sea Level at M= .85, .7, .5, .2,
- 20,000 ft. at M= .85, .7, .5.
- 40,000 ft. at M= .85, .7, .5.

The basic configurations tested were full and empty tanks with the small tail (see Figure 1), set at -2° incidence to the aircraft datum. These configurations were tested at the ten flight conditions.

The empty tank configuration was also investigated for low speed sea level conditions using -3° incidence and the small tail, and -2° incidence with the large tail. The large tail was 1.2 times the size of the small tail.

4.2 SERIES II

As a result of the series 1 tests, the tank models were re-tested with the release occurring after rotation thru about 5° from the initial position.

The full and empty tanks configurations with the small tail and -2° incidence to the aircraft datum were used. Both configurations were tested at the ten flight conditions outlined above with the aircraft at zero yaw and 5° yaw to the left.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIE

REPORT No P/Wind Tunnel/138

TEST No 6

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIE

PREPARED BY

DATE

G. Dimock

Dec. 1957

CHECKED BY

DATE

5.0 TEST RESULTS - SERIES I

The jettison tests performed in this series are listed in the schedule of test films given in Table 3. The high speed test films were studied by projecting them at 16 frames per second and also by means of a frame by frame analysis using a film viewer giving about twenty times magnification. The results of this analysis are summarized in Table 4.

5.1 DISCUSSION

The film analysis indicated that there were a relatively large number of cases in which the model tail fin appeared to interfere with the aircraft fuselage.

The summary in Table 4 lists three instances for the -2° incidence, small tail full tank configuration where the tail appeared to come very close (Runs 8,9, and 6) and possibly hit the fuselage, and three cases in which the tail came close (Runs 10,4,1). These cases occurred mainly at the two lower altitudes simulated. Empty tank tests with the same configuration produced two cases where the tail came close (Runs 11 and 20) at 40,000 ft.

There was one run (22) for the -3° incidence small tail empty tank configuration where the tail came very close, and there were two that only came close (Runs 23 and 25).

When the test films were projected the model tail in Runs 8,9 and 25 appeared to hit the fuselage, ie., the tail moved up towards the fuselage as the tank pitched nose down and appeared to bounce off the fuselage. Runs 10,6,1, and 22 were considered to have come very close to hitting the fuselage.

Although tests using the -3° incidence small tail configuration were only conducted for empty tank, sea level conditions, it can be seen that if the full tank, -2° incidence, small tail configuration interferes frequently with the fuselage, the full tank would also interfere using -3° incidence. Thus the use of -3° incidence for jettison purposes would be generally unsatisfactory.

The effect of increasing the tail size is indicated by comparing Runs 15 and 16 with Runs 21 and 24. Unfortunately only low speed conditions were checked but the increased tail size appears to have a slight beneficial effect, on the basis of these few tests. The pitching motion at very low speed remained the same, but at $M=0.5$, was reduced from approximately 16° to 12° .

UNCLASSIFIED / NON CLASSIFIÉ
~~CONFIDENTIAL~~



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

REPORT No. P/Wind Tunnel/138

SHEET No.

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Dec. 1957

CHECKED BY

DATE

On the basis of the results of this test series it was concluded that the jettison of a full scale, -2° incidence, small tail tank configuration would be unsatisfactory, in that the tank would interfere with the fuselage. A recommendation was made that tests be conducted using the -2° incidence small tail configuration to investigate the effect of reducing the release angle to 5° .



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIED

REPORT No. P/Wind Tunnel/138

SHEET No. 8

| | | | |
|-------------------------------|-------------------------------|-------------|------------|
| AIRCRAFT: <u>ARROW</u> | UNCLASSIFIED / NON CLASSIFIED | PREPARED BY | DATE |
| | | G.K. Dimock | Dec. 1957. |
| | | CHECKED BY | DATE |

6.0 TEST RESULTS - SERIES II

The jettison tests performed in Series II are listed in the schedule of test films given in Table 5. The high speed test films were studied in the same manner as the Series I test films. The results of the film analysis, with particular emphasis on roll and yaw angles at the release, are summarized in Table 6.

6.1 Discussion

The analysis data in Table 6 lists only three runs where the tail of the tank model came close to interfering with the aircraft fuselage (Runs 4, 13, 15). These cases are for empty tanks with the aircraft at zero yaw (Run 4, 20,000 feet), and 5° yaw to the left (Run 13, sea level, and Run 15, 40,000 feet).

For this test series closeness to the fuselage was based on the percentage reduction in the initial tail-fuselage clearance estimated from the films. For the runs referred to above, the reduction in the initial clearance was 55% to 60%. When the films were projected, Run 4 was judged to have come close, and in Run 13, although the tail never actually hit the fuselage according to the frame - by - frame analysis, the tail appeared to bounce off the fuselage. In this latter case the model probably hesitated slightly as the swivel pin freed itself from the mounting plate in the aircraft model.

In contrast with the previous test series, all of the full tank models jettisoned at either 0° or 5° of yaw came free satisfactorily, with only a moderate amount of tail movement towards the aircraft (25% average). The reduction of the release angle reduced the nose down attitude of the full tanks after release by 2° to 10° with the aircraft at zero yaw. Thus the tail would not tend to move towards the fuselage as much in this test series. The empty tank pitching was not noticeably affected by the reduction in release angle, and these models tended to pitch tail-up towards the fuselage more consistently than the full tanks. When the aircraft model was yawed, the full tank tail-up pitching reduced; whereas, the tail-up motion of the empty tanks increased, even for the few cases tested.

This initial motion is contrasted in the Series II high-speed film strip reproductions given in Figures 5 and 6. In Figure 5, the tail did not move towards the fuselage, and in Figure 6, the initial tail clearance was reduced by about 55%.

On the basis of the dynamic model jettison tests conducted in this series, the 5° release angle and the -2° incidence small



AVRO AIRCRAFT LIMITED
MALTON, ONTARIO

TECHNICAL DEPARTMENT

REPORT NO. P/Wind Tunnel/138

SHEET No. 9

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

tail tank configurations were adopted by the Technical Design Department for the Arrow.

6.2 Roll and Yaw Angles at Release

The roll and yaw angles at the 5° release angle given in Table 6 were determined from the test films to provide limiting angles for the design of the aft swivel pin. The maximum angles originally issued were: roll $\pm 15^\circ$, yaw $\pm 10^\circ$. More recently, when the problem of the design of the fuel line coupling between the tank and the fuselage arose, the films were re-analyzed, and it was found that the maximum yaw limit was closer to $\pm 5^\circ$, as indicated in Table 6.

The roll and yaw angles of the tank as it pitches down can be assumed to vary linearly with pitch angle from zero values at the initial position to the maximum values at the 5° release angle. It should be remembered that these limiting values apply for level flight conditions.

The roll angles at release for the full tank ($\psi = 0$ and -5°), and empty tank ($\psi = 0^\circ$), are moderate (0 to 5°); whereas for the empty tank at 5° of yaw the roll angle increases 10° to 15° . Similarly the yaw angles at release for the full and empty tanks ($\psi = 0$) are moderate (less than 3°); whereas for the full tank (sea level, $\psi = -5^\circ$), and empty tank ($\psi = -5^\circ$), the yaw angle increases to 5° .

The rolling and yawing motion of the tank models illustrating moderate conditions are shown in Figure 5, and the limit angles are shown in Figure 6.

6.3 Tank - Missile Clearance

The problem of Sparrow missile-long range tank interference when the missiles must either be fired or jettisoned while the tank is still in use was also investigated.

The time taken for the missile to reach its fully extended position after the missile doors start to open is $1\frac{1}{4}$ seconds. It was established from the aircraft-missile launcher geometry that the top of the tank forward pylons should be at least six feet below the fuselage before the missile doors started to open to ensure that the tank would be well away before the missiles were fully extended. Cases for which the time taken by the tank to drop the required six feet would be the least were analyzed and the results are listed in Table 7. These data were used to establish requirements for time delays between tank and missile jettison signals.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ
CONFIDENTIAL

REPORT No. P/Wind Tunnel/138

SHEET No. 10

| | | |
|-------------------------------|------------------------------|------------|
| AIRCRAFT: <u>ARROW</u> | UNCLASSIFIED / NON CLASSIFIÉ | |
| | PREPARED BY | DATE |
| | G.K. Dimock | Dec. 1957. |
| | CHECKED BY | DATE |

The tabulated values show that the tank would always be well clear of the aircraft before the missiles were fully extended. The values issued were .5 to .7 seconds for full tank, and .2 to .5 seconds for empty tank. The maximum values occurred at low speed and high altitude, e.g., M= .5 at 40000 feet.

6.4 Model Trajectories

At zero yaw, the full tank models fell straight down below the aircraft with little aft or lateral motion. The empty tanks tended to move outboard more than the full tanks. With 5° of yaw the full tank models moved well outboard of the airplane as they fell, except for the 40,000 feet models which tended to remain below the aircraft as they dropped away. All altitude models of the empty tank moved well outboard when the airplane model was yawed.

Typical trajectories are illustrated in Figures 5 and 6. In Figure 5, the model fell straight down below the airplane, and in Figure 6, the outboard motion with the airplane yawed is evident. In the front views, the models disappear from view at a distance about .2b to .25b below the aircraft model.



AVRO AIRCRAFT LIMITED
MALTON ONTARIO

TECHNICAL DEPARTMENT

~~CONFIDENTIAL~~

REPORT No. P/Wind Tunnel/138

SHEET No. 11

AIRCRAFT:

ARROW

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

UNCLASSIFIED / NON CLASSIFIÉ

7.0 PROPOSED FLIGHT JETTISON TEST PROGRAMME

The following basic programme was proposed for jettison tests of the long range fuel tank from the Arrow at 1 (approximately) flight conditions:

| | <u>ALTITUDE</u> | <u>MACH NO.</u> | <u>SIDESLIP ANGLE</u> | <u>JETTISON CASE</u> |
|-----|-------------------|-----------------|-----------------------|---|
| (A) | <u>Full Tank</u> | | | |
| | Sea level | .3 | 0° | After take-off, at 200 kts. |
| | 20,000 | .7 | 0° | Full or nearly full tank jettisoned half-way along climb to limiting altitude for the tank. |
| | 20,000 | .7 | 5° | |
| (B) | <u>Empty Tank</u> | | | |
| | Sea level | .3 | 0° | At the end of subsonic flight, on approach. |
| | 40,000 | .7 | 0° | At the end of subsonic climb to limiting altitude. |
| | 40,000 | .7 | 5° | |

The above conditions were based on the Series II test results. At 20,000 feet, M=.7 simulated level flight conditions, the full tanks tended to pitch tail-up towards the fuselage, and there was a moderate amount of roll before the swivel pin cleared the fuselage. The empty tanks showed the same effects at 20,000 feet and 40,000 feet for the Mach number range .5 to .85, except that the effects were slightly worse. That is, the initial rolling angles of the empty tanks were about 10°, or more (especially with $\psi = \pm 5^\circ$), and the tail appeared to come very close to the fuselage in a few cases.



AVRO AIRCRAFT LIMITED
MALTON, ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ

REPORT No. P/Wind Tunnel/138

SHEET No. 12

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

8.0 CONCLUSIONS

Based on the dynamic tests of .07 scale models, the following conclusions for jettison characteristics of the long range fuel tank from the full scale Arrow can be made:

1. Satisfactory jettison characteristics were obtained for a tank configuration with the small tail (see Figure 1), -2° to the fuselage datum and a 5° release angle.
2. In some isolated cases, the tests indicated that the horizontal tail of the tank may come close to the fuselage, although there were no positive instances of contact. Tail-up motion will be more severe for jettisoned empty tanks than for full tanks. Reductions in initial tail clearance up to the order of 60% were observed in the tests.
3. Jettisoned full tanks will generally fall straight down below the aircraft, except at low altitudes with sideslip angles of the order of $+5^{\circ}$, when the tanks will also move outboard as they fall. Jettisoned empty tanks will generally move outboard as they fall below the aircraft. The direction of outboard motion at zero yaw would depend on the conditions existing when the tank is released.
4. The tanks will jettison clear of the aircraft at all speeds and altitudes within the tank flight envelope 1 g conditions (dive brakes closed).
5. The speed brake fully open configuration was not investigated during these jettison tests. A study of the tank-extended dive brake geometry showed that interference between jettisoned tanks and the speed brakes was probable, considering the motion of the tanks after release. Unless further jettison tests with the extended speed brake configuration are performed, it must be assumed that for all flight conditions within the flight envelope of the tank, interference between jettisoned tanks and fully extended speed brakes is possible. Therefore the speed brakes must be closed before the long range tank is jettisoned.
6. The outflows underneath the fuselage will create rolling and yawing motions of the tanks as they pitch down to the release angle. The maximum roll and yaw angles at the 5° release angle will be of the order of $+15^{\circ}$ of roll and $+5^{\circ}$ of yaw for level flight conditions. The maximum angles occurred for empty tanks jettisoned with the aircraft yawed 5° .
7. Assuming that the mechanical release mechanism on the models reasonably simulated the full scale design, the jettison tests showed that the initial tank motions will not cause the tank to jam in the release mechanism and fail to release.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

CONFIDENTIAL
UNCLASSIFIED / NON CLASSIFIÉ

REPORT NO. _____

SHEET NO. _____

PREPARED BY _____

DATE _____

CHECKED BY _____

DATE _____

AIRCRAFT: _____

UNCLASSIFIED / NON CLASSIFIÉ

APPENDIX

DESIGN AND TEST DATA FOR TANK

JETTISON TESTS



AVRO AIRCRAFT LIMITED

TECHNICAL DEPARTMENT (Aircraft)

~~CONFIDENTIAL~~

REPORT NO. P/Models/44

SHEET NO. 348

PREPARED BY

DATE

G.K. Dimock

June 1956.

CHECKED BY

DATE

AIRCRAFT:

C-105

N.A.E. LOW SPEEDUNCLASSIFIED / NON CLASSIFIED WIND TUNNEL TESTSDESIGN AND TEST DATA FOR MODEL JETTISONING TESTSModel Scale: $\lambda_m = .07 \lambda_{fs}$ Design and Test Data

| EQUIVALENT ALTITUDE ft. | EQUIVALENT MACH NUMBER | FULL SCALE T.A.S. m.p.h. | TUNNEL T.A.S. f.p.s. | TUNNEL DYNAMIC PRESSURE q _{dial} p.s.f. | AIRPLANE ANGLE OF ATTACK degrees | TANK MODEL WEIGHT | | SEAT MODEL WEIGHT lbs. | PILOT MODEL WEIGHT lbs. |
|----------------------------|------------------------|-----------------------------|-------------------------|--|-------------------------------------|-------------------|--------------|---------------------------|----------------------------|
| | | | | | | Empty lbs. | Full lbs. | | |
| S.I. | .2 | 152 | 59 | 4.4 | 12.8 | .106 | 1.451 | .021 | .080 |
| | .5 | 380 | 147.5 | 27.6 | 2.3 | | | | |
| | .7 | 533 | 207 | 54.4 | 1.3 | | | | |
| | .85 | 647 | 251 | 80.0 | .9 | | | | |
| 20,000 | .5 | 353.5 | 137.2 | 23.9 | 5.4 | .200 | 2.726 | .039 | .150 |
| | .7 | 494 | 192 | 46.8 | 2.6 | | | | |
| | .85 | 600 | 233 | 68.9 | 1.8 | | | | |
| 40,000 | .5 | 331 | 128.6 | 21.0 | 13.7 | .435 | 5.930 | .084 | .327 |
| | .7 | 464 | 180 | 41.1 | 6.7 | | | | |
| | .85 | 563 | 218 | 60.4 | 4.4 | | | | |



AVRO AIRCRAFT LIMITED

TECHNICAL DEPARTMENT (Aircraft)

CONFIDENTIAL
UNCLASSIFIED / NON CLASSIFIÉ

| | | |
|-------------|-------------|--|
| REPORT NO. | P/MODELS/44 | |
| SHEET NO. | 34b | |
| PREPARED BY | DATE | |
| G.K. Dimock | June 1956 | |
| CHECKED BY | DATE | |
| | | |

| | |
|-----------|-------|
| AIRCRAFT: | C-105 |
|-----------|-------|

UNCLASSIFIED / NON CLASSIFIÉ

Design and Test Data: (Continued)

Model radii of gyration = .07 full scale values.
 Model C.G. to be in the same position as for the full scale body.
 Models to be geometrically similar to full scale bodies except for small details.
 Model time intervals along a trajectory will be = $\sqrt{.07}$ full scale values.
 Seat model ejection velocity = 21.2 f.p.s. at all altitudes.

NOTE:

(1) Model weights were based on the following full scale weights:

| | | |
|---------------|---|----------|
| Tank - empty | : | 310 lbs. |
| Tank - full | : | 4235 |
| Ejection Seat | : | 60 |
| Pilot | : | 233 |

(2) Seat model ejection velocity based on full scale ejection velocity of 80 f.p.s.

(3) Airplane angle of attack taken as angle to trim at T.A.S. (level flight with C.G. at .31 c).

(4) $q_{true} = .936 q_{dial}$

UNCLASSIFIED / NON CLASSIFIÉ



AVRO AIRCRAFT LIMITED
MALTON, ONTARIO

TECHNICAL DEPARTMENT

REPORT No. P/Wind Tunnel /138

SHEET No. Tables

AIRCRAFT:

C-105

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

TABLES.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

REPORT No. P/Wind Tunnel/138

SHEET No. _____

AIRCRAFT:

CF-105

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

UNCLASSIFIED / NON CLASSIFIÉ

TABLE 1

TANK MODEL CONFIGURATIONS AND DESIGNATIONS

| <u>EMPTY</u> | <u>FULL</u> | <u>INITIAL INCIDENCE</u> | |
|--------------|-------------|--|------------------|
| | | <u>W.r.t.</u> <u>AIRCRAFT DATUM</u> | <u>TAIL SIZE</u> |
| A,B,C, | D,E,F, | -2° | Small |
| G | | -3° | Small |
| H | | -2° | Large |

| <u>EMPTY</u> | <u>FULL</u> | <u>SIMULATED ALTITUDE</u> |
|--------------|-------------|---------------------------|
| A,G,H, | D | Sea Level |
| B | E | 20,000 |
| C | F | 40,000 |

Large tail size = 1.2x small tail size

TEST SERIES I

Configurations used: A to H inclusive

Release after rotation through 7½° from initial attitude.

TEST SERIES II

Configurations used: A to F inclusive

Release after rotation through 5° from initial attitude.



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIED

REPORT No. P/Wind Tunnel/138

SHEET NO.

AIRCRAFT:

C-105

UNCLASSIFIED / NON CLASSIFIED

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

TABLE 2

DYNAMIC PROPERTIES OF MODELS

1.0 Tank Full Models

| <u>SIMULATED ALTITUDE</u> | <u>PROPERTY</u> | <u>REQUIRED VALUE</u> | <u>ACTUAL VALUE</u> | <u>% ERROR</u> |
|---------------------------|-------------------|---------------------------|---------------------------|----------------|
| Sea Level | Weight W | 1.451 lb. | 1.451 lb. | |
| | Roll Inertia Ixx | .7614 lb.in. ² | .7775 lb.in. ² | 2.1 |
| | Pitch Inertia Iyy | 25.141 | 25.358 | |
| | Yaw Inertia Izz | 25.141 | 25.347 | |
| 20,000 | W | 2.726 | 2.726 | |
| | Ixx | 1.428 | 1.267 | -11.3 |
| | Iyy | 47.170 | 47.992 | |
| | Izz | 47.170 | 47.981 | |
| 40,000 | W | 5.930 | 5.930 | |
| | Ixx | 3.114 | 3.348 | 7.5 |
| | Iyy | 102.83 | 105.84 | 2.9 |
| | Izz | 102.83 | 105.85 | 2.9 |

2.0 Tank Empty Models

| | | | | |
|-----------|-----|--------|--------|-------|
| Sea Level | W | .106 | .106 | |
| | Ixx | .0989 | .1096 | 10.8 |
| | Iyy | 2.546 | 2.559 | |
| | Izz | 2.546 | 2.550 | |
| 20,000 | W | .200 | .200 | |
| | Ixx | .1856 | .1394 | -24.9 |
| | Iyy | 4.777 | 4.791 | |
| | Izz | 4.777 | 4.790 | |
| 40,000 | W | .435 | .435 | |
| | Ixx | .4046 | .1785 | - 5.6 |
| | Iyy | 10.413 | 10.301 | |
| | Izz | 10.413 | 10.340 | |



AVRO AIRCRAFT LIMITED
MALTON ONTARIO

TECHNICAL DEPARTMENT

REPORT No. P/Wind Tunnel/138

SHEET No. 1

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Aug. 1956.

CHECKED BY

DATE

TABLE 3

.07 SCALE TANK JETTISON TESTS - SERIES I

SCHEDULE OF TEST FILMS

In the complete film of these tests, the test films will appear in the same order as the film numbers given below. The Avro reference number for the Arrow tank jettison film, Series I is 8-77

1.0 TANK FULL

1.1 Configuration: -2° Incidence, Small Tail

| <u>Film No.</u> | <u>Simulated Altitude</u> | <u>Full Scale Mach No.</u> |
|-----------------|---------------------------|----------------------------|
| 7 | Sea Level | .20 |
| 8 | | .50 |
| 9 | | .70 |
| 10 | | .85 |
| 6 | 20,000 | .50 |
| 5 | | .70 |
| 4 | | .85 |
| 3 | 40,000 | .50 |
| 2 | | .70 |
| 1 | | .85 |

2.0 TANK EMPTY

2.1 Configuration: -2° Incidence, Small Tail

| | | |
|----|-----------|-----|
| 15 | Sea Level | .20 |
| 16 | | .50 |
| 17 | | .70 |
| 18 | | .85 |
| 13 | 20,000 | .50 |
| 14 | | .70 |
| 19 | | .85 |
| 11 | 40,000 | .50 |
| 12 | | .70 |
| 20 | | .85 |



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ

REPORT No. P/Wind Tunnel/138

SHEET No. ii

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

PREPARED BY

DATE

G.K. Dimock

Aug. 1956.

CHECKED BY

DATE

2.2 Configuration -3° Incidence, Small Tail

| <u>Film No.</u> | <u>Simulated Altitude</u> | <u>Full Scale Mach No.</u> |
|-----------------|---------------------------|----------------------------|
| 22 | Sea Level | .20 |
| 23 | | .50 |
| 25 | | .70 |

2.3 Configuration -2° Incidence, Large Tail

| | | |
|----|-----------|-----|
| 21 | Sea Level | .20 |
| 24 | | .50 |

TABLE 4 (a) - SUMMARY OF FILM ANALYSIS - SERIES I

TEST CONDITIONS: Tank Full, - 2° incidence, small tail - Aircraft at zero yaw

| RUN NO. | ALT | M | Q _C | INITIAL ROLL | INITIAL YAW | INTERFERENCE WITH AIRCRAFT | REMARKS |
|---------|-------|-----|----------------|------------------|------------------|--|--|
| 8 | S.I. | .5 | 2.3 | R slightly (45°) | R | Tail appeared to come very close to fuselage | Tank pitched thru approx. 23° nose down (from initial position) at release, tank fell straight down below the A/C. |
| 9 | | .7 | 1.3 | R slightly | R, 45° | Tail came very close | Pitched nose down 21°, fell straight down below the A/C. |
| 10 | | .85 | .9 | R slightly | R, 45° | Tail came close | Pitched nose down 20°, fell below A/C, moved to right slightly. |
| 6 | 20000 | .5 | 5.4 | R very slightly | R, very slightly | Tail came very close | Pitched nose down 22°, fell straight down below A/C. |
| 5 | | .7 | 2.6 | R slightly | R slightly | None | Little pitching just below A/C, nose eventually pitched down 15°, tank fell straight down below A/C. |
| 4 | | .85 | 1.8 | R | None | Tail came close | Pitched nose down 22°, fell straight down below A/C. |
| 3 | 40000 | .5 | 13.7 | None | None | None | Model pitched to horizontal, then nosed down 10°, fell straight down below A/C. |
| 2 | | .7 | 6.7 | R | R slightly | None | Pitched nose down 17°, fell straight down below A/C. |
| 1 | | .85 | 4.4 | R | R slightly | Tail came close | Pitched nose down 20°, fell straight down below A/C. |

R = to the right

L = to the left

NOTE: The initial roll and yaw angles were estimated for the period in which the models fell a tank body diameter below the aircraft fuselage. These angles are approximate and only serve to indicate rates of angular rotation.

The trajectory descriptions given in the remarks cover the model motion ^{.25b} within of the fuselage.

P/Wind Tunnel/138
Series I

UNCLASSIFIED / NON CLASSIFIÉ

UNCLASSIFIED / NON CLASSIFIÉ

UNCLASSIFIED / NON CLASSIFIED

P/Wind Tunnel/138
Series I

TABLE 4 (b) - SUMMARY OF FILM ANALYSIS - SERIES I

TEST CONDITIONS: Tank Empty, - 2° incidence, small tail - Aircraft at zero yaw

| RUN NO. | ALT | M | Q ^c | INITIAL ROLL | INITIAL YAW | INTERFERENCE WITH AIRCRAFT | REMARKS |
|---------|-------|-----|----------------|-------------------------------------|-------------|---|---|
| 15 | S.L. | .2 | 12.8 | L slightly | R, 45° | None, tail moved towards A/C. | Model pitched to horizontal, moved outboard to the right as it fell. |
| 16 | | .5 | 2.3 | L initially, then motion stabilized | R, 45° | None, | Pitched nose down 16°, moved outboard (R) as it fell below A/C. |
| 17 | | .7 | 1.3 | L very slightly, then reversed to R | R | None, tail moved towards A/C. | Pitched nose down 18°, moved outboard (R) as it fell below A/C. |
| 18 | | .85 | .9 | R slightly | | None, tail moved towards A/C. | Pitched nose down 15°, moved outboard (R) past wing strut position (.2b from centre line) as it fell. |
| 13 | 20000 | .5 | 5.4 | R slightly | | None, tail moved towards A/C. | Pitched nose down 14°, moved outboard (R) past wing strut position. |
| 14 | | .7 | 2.6 | R slightly | | None | Pitched nose down 13° moved outboard (R to .2b) as it fell below A/C. |
| 19 | | .85 | 1.8 | R | | None, tail moved towards A/C. | Pitched nose down 14° moved outboard (R to .2b) as it fell below A/C. |
| 11 | 40000 | .5 | 13.7 | L initially then reversed to R | | Tail came close | Fitted to horizontal, moved outboard (R to .2b). |
| 12 | | .7 | 6.7 | R | R | None, tail moved towards A/C. | Pitched nose down 17°, moved outboard (R to .2b) |
| 20 | | .85 | 4.4 | L very rapidly, 45° | L, 45° | Came close, model rolled and fin came close to fuselage | Pitched nose down 12°, eventually rolled thru 180° as it fell straight down below A/C. |

b = wing span.

R = to the right
L = to the left

UNCLASSIFIED / NON CLASSIFIED

TABLE 4 (c) - SUMMARY OF FILM ANALYSIS - SERIES I

TEST CONDITIONS: Tank Empty, -30° incidence, small tail - Aircraft at zero yaw

| RUN NO. | ALT | M | Q^2 | INITIAL ROLL | INITIAL YAW | INTERFERENCE WITH AIRCRAFT | REMARKS |
|---------|------|----|-------|---------------|------------------------------|---|---|
| 22 | S.L. | .2 | 12.8 | L, 45° | R | Tail came very close to fuselage | Pitched to horizontal, nose swung outboard (R) as it fell below A/C. |
| 23 | | .5 | 2.3 | L slightly | R slightly | Tail came close | Pitched nose down 12° , fell straight down below A/C. |
| 25 | | .7 | 1.3 | R | L slightly initially, then R | Tail came close as model rolled up towards A/C. | Pitched nose down 16° , fell with nose pitched down and yawed to R, but model did not move outboard very much. |

TABLE 4 (d)

TEST CONDITIONS: Tank Empty, -2° incidence, large tail Aircraft at zero yaw

| | | | | | | | |
|----|------|----|------|------|---|---------------------------------------|--|
| 21 | S.L. | .2 | 12.8 | L | R | None, tail moved towards A/C slightly | Pitched to horizontal, moved outboard (R) as it fell. |
| 24 | | .5 | 2.3 | None | R | None | Pitched nose down 12° , moved outboard (R to .2b) |

R = to the right
L = to the left

UNCLASSIFIED / NON CLASSIFIED
P/wind Tunnel/138
Series I

UNCLASSIFIED / NON CLASSIFIED



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

~~CONFIDENTIAL~~
~~UNCLASSIFIED / NON CLASSIFIE~~

REPORT NO. Wind Tunnel/138

SHEET NO. 1

AIRCRAFT:

ARROW

~~UNCLASSIFIED / NON CLASSIFIE~~

PREPARED BY

DATE

G.K. Dimock

Nov. 1956.

CHECKED BY

DATE

TABLE 5

.07 SCALE TANK JETTISON TESTS - SERIES II

SCHEDULE OF TEST FILMS

In the complete film of these tests the test films will appear in the same order as the film numbers given below. The Avro reference number for the Arrow tank jettison film, Series II is 12-49

Configuration: - 2° Incidence, Small Tail Release after 5°

1.0 TANK FULL

1.1 Aircraft at zero yaw ($\psi = 0^\circ$)

| <u>FILM NO.</u> | <u>SIMULATED ALTITUDE</u> | <u>FULL SCALE MACH NO.</u> |
|---------------------------|---------------------------|----------------------------|
| 30 | Sea Level | .2 |
| 7 | | .5 |
| 26 | | .7 |
| 31 (Front camera removed) | | .7 |
| 8 | | .85 |
| 9 | 20,000 | .5 |
| 27 | | .7 |
| 10 | | .85 |
| 11 | 40,000 | .5 |
| 28 | | .7 |
| 12 | | .85 |

1.2 Aircraft yawed 5° to port ($\psi = -5^\circ$)

| | | |
|----|-----------|-----|
| 17 | Sea Level | .5 |
| 23 | | .7 |
| 18 | | .85 |
| 19 | 20,000 | .5 |
| 24 | | .7 |
| 22 | | .85 |
| 20 | 40,000 | .5 |
| 25 | | .7 |
| 21 | | .85 |

UNCLASSIFIED / NON CLASSIFIED
CONFIDENTIAL



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

REPORT No. P/Wind Tunnel/138

SHEET No. 11

PREPARED BY DATE

G.K. Dimock

Nov. 1956.

CHECKED BY DATE

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIED

2.0 TANK EMPTY

2.1 Aircraft at zero yaw ($\psi = 0$)

| <u>FILM NO.</u> | <u>SIMULATED ALTITUDE</u> | <u>FULL SCALE MACH NO.</u> |
|-----------------|---------------------------|----------------------------|
| 1 | Sea Level | .5 |
| 2 | | .85 |
| 3 | 20,000 | .5 |
| 4 | | .85 |
| 5 | 40,000 | .5 |
| 29 | | .7 |
| 6 | | .85 |

2.2 Aircraft yawed 5° to port ($\psi = -5^\circ$)

| | | |
|----|-----------|-----|
| 13 | Sea Level | .50 |
| 14 | 20,000 | .50 |
| 15 | 40,000 | .50 |
| 16 | | .85 |

TABLE 6 (a) - SUMMARY OF FILM ANALYSIS - SERIES II

TEST CONDITIONS: Tank Full, Aircraft at zero yaw

| RUN NO. | ALT | M | Q ^o | INITIAL ^a | | WITHIN .2b OF FUSELAGE YAW | INTERFERENCE WITH AIRCRAFT | REMARKS |
|---------|-------|-----|----------------|----------------------|------|----------------------------|-------------------------------------|--|
| | | | | ROLL | YAW | | | |
| 30 | S.I. | .2 | 12.8 | 0 | 0 | R slightly | None, tail moved away from fuselage | Model pitched to horizontal, fell straight down below A/C. |
| 7 | | .5 | 2.3 | 0 | <1.2 | R slightly | None, tail moved towards A/C (32%) | Model pitched thru approx. 22° nose down (from initial position) at release. Fell straight down below A/C. in yawed. 20° nose down attitude. |
| 26 | | .7 | 1.3 | 0 | <1.2 | R, 45° | None (14%) | Pitched nose down 18°, moved slightly outboard (R) as it fell. |
| 8 | | .85 | .9 | 0 | 1.5 | R 90° | None (43%) | Pitched nose down 18°, moved slightly outboard (R) as it fell. |
| 9 | 20000 | .5 | 5.4 | 0 | <1.2 | R slightly | None (20%) | Pitched nose down 13°, fell straight down below A/C. |
| 27 | | .7 | 2.6 | 4 | 1.3 | L initially then R | None (32%) | Pitched nose down 16°, slight outboard motion. |
| 10 | | .85 | 1.8 | 0 | <1.2 | R slightly | None (38%) | Pitched nose down 15°, fell straight down below A/C. |
| 11 | 40000 | .5 | 13.7 | 0 | <1.2 | L slightly | None, tail moved down | Pitched to horizontal, fell straight down below A/C. |
| 28 | | .7 | 6.7 | <1.5 | <1.2 | R slightly | | Pitched nose down 14°, fell straight down below A/C. |
| 12 | | .85 | 4.4 | 1.5 | 1.2 | L slightly | | Pitched nose down 12°, fell straight down below A/C. |

R = to the right
L = to the left

^a Initial roll and yaw angles were measured to within ± 1° at the point where the aft swivel pin just cleared the fuselage, ie., at 5° release angle.

^b % figure gives approximate reduction in initial tail-fuselage clearance.

Note: The roll and yaw angles given for the distance covered by the film (within .2b to .25b below fuselage) are approximate and only serve to indicate rates of angular rotation. The trajectory descriptions given in the remarks cover the model motions within .25b of the fuselage.

b = wing span

CONFIDENTIAL

P/Wind Tunnel/138
Series II

UNCLASSIFIED / NON CLASSIFIED

UNCLASSIFIED / NON CLASSIFIED

TABLE 6 (b) - SUMMARY OF FILM ANALYSIS - SERIES II

TEST CONDITIONS: Tank Full, Aircraft yawed 5° left

| RUN NO. | ALT | M | C | INITIAL | | WITHIN .2b OF FUSELAGE | | INTERFERENCE WITH AIRCRAFT | REMARKS |
|---------|-------|-----|------|---------|------|------------------------|------------|-------------------------------------|--|
| | | | | ROLL | YAW | ROLL | YAW | | |
| 17 | S.L. | .5 | 2.3 | 5.5 | 5 | L, 45° | L > 45° | None, tail moved towards A/C. (9%) | Pitched nose down thru 12° approx., moved outboard (L) to wing strut position (.2b from centre line) as it fell. |
| 23 | | .7 | 1.3 | 6.5 | 2.8 | L > 90° | L > 45° | None, tail moved away from fuselage | Pitched nose down 15°, moved outboard (L to .2b) as it fell below A/C. |
| 18 | | .85 | .9 | 4.5 | 1.7 | L > 90° | L > 45° | | Pitched nose down 12°, moved outboard (L to .2b) as it fell. |
| 19 | 20000 | .5 | 5.4 | 2.5 | 1.7 | L < 90° | L < 45° | | Pitched nose down 14°, moved outboard (L) as it fell. |
| 24 | | .7 | 2.6 | 3.5 | 1.9 | L, 45° | L, 45° | None (20%) | Pitched nose down 12°, moved outboard (L) as it fell. |
| 22 | | .85 | 1.8 | 1.5 | 2.0 | L, 90° | L > 45° | None (9%) | Pitched nose down 12°, moved outboard (L to .2b) as it fell. |
| 20 | 40000 | .5 | 13.7 | <1.5 | <1.2 | L slightly | L slightly | None, tail moved away from fuselage | Model fell as it pitched to horizontal, fell almost straight down below A/C. |
| 25 | | .7 | 6.7 | 0 | <1.2 | L slightly | L < 45° | | Model fell as it pitched nose down 13°, fell almost straight down below A/C. |
| 21 | | .85 | 4.4 | 0 | <1.2 | L, 45° | L, 45° | | Model fell below A/C. before it pitched nose down 9°. |

R = to the right
L = to the left

CONFIDENTIAL

Wind Tunnel/138
Series II

UNCLASSIFIED / NON CLASSIFIED

UNCLASSIFIED / NON CLASSIFIED

TABLE 6 (c) - SUMMARY OF FILM ANALYST- SERIES II

TEST CONDITIONS: Tank Empty, Aircraft at zero yaw

| FROM NO. | ALT | M | α° | INITIAL ROLL | INITIAL YAW | WITHIN .2b ROLL | .2b OF FUSELAGE YAW | INTERFERENCE WITH AIRCRAFT | REMARKS |
|----------|-------|-----|------------------|--------------|-------------|-----------------------------|---------------------|-------------------------------------|--|
| 1 | S.I. | .5 | 2.3 | 6.5 | 2.2 | L slightly | R slightly | None, tail moved towards A/C. (32%) | Pitched nose down thru 12° approx., moved outboard (R) as it fell. |
| 2 | | .85 | .9 | 1.5 | 3.0 | R slightly | R>45° | None (32%) | Pitched nose down 15°, nose swung outboard (R to .2b) as it fell. |
| 3 | 20000 | .5 | 5.4 | 5.5 | 1.7 | L initially then R slightly | R>45° | None (20%) | Pitched nose down 15°, nose swung outboard (R to .2b) as it fell. |
| 4 | | .85 | 1.8 | 3.5 | 1.2 | | R<45° | Tail came close to fuselage (60%) | Pitched nose down 18°, fell almost straight down below A/C. |
| 5 | 40000 | .5 | 13.7 | 5 | 1.7 | | R>45° | None (43%) | Pitched to horizontal, moved outboard (R to .2b) as it fell. |
| 29 | | .7 | 6.7 | 2 | 1.2 | R slightly | R, 45° | None | Model fell straight down below A/C. as it pitched nose down 16°. |
| 6 | | .85 | 4.4 | 3 | 1.7 | R, 45° | R>45° | None (43%) | Pitched nose down 16°, nose swung outboard (R to .2b) as it fell. |

TABLE 6 (d)
TEST CONDITIONS: Tank Empty, Aircraft yawed 5° left

| FROM NO. | ALT | M | α° | INITIAL ROLL | INITIAL YAW | WITHIN .2b ROLL | .2b OF FUSELAGE YAW | INTERFERENCE WITH AIRCRAFT | REMARKS |
|----------|-------|-----|------------------|--------------|-------------|----------------------------|---------------------|-----------------------------------|--|
| 13 | S.I. | .5 | 2.3 | 14.5 | 4.2 | R initially then to L | L>45° | Tail came close to fuselage (55%) | Pitched nose down 17°, model nose hit L wing strut. |
| 14 | 20000 | .5 | 5.4 | 8 | 4.5 | | | None (32%) | Pitched nose down 12°, model nose moved past L wing strut before hitting it. |
| 15 | 40000 | .5 | 13.7 | 8 | 4.2 | R initially then L 45° | | Tail came close (60%) | Pitched nose down 16°, model nose moved past L wing strut before hitting it. |
| 16 | | .85 | 4.4 | 14 | 4.2 | R initially then L rapidly | | None (43%) | Pitched nose down 14° model nose moved past L wing strut before hitting it. |

R = to the right
L = to the left

b = wing span

CONFIDENTIAL

P/Wind Tunnel/138
Series II

UNCLASSIFIED / NON CLASSIFIED

UNCLASSIFIED / NON CLASSIFIED



AVRO AIRCRAFT LIMITED
MALTON - ONTARIO

TECHNICAL DEPARTMENT

UNCLASSIFIED / NON CLASSIFIÉ
Wind Tunnel/138
REPORT NO.

SHEET No.

PREPARED BY

DATE

G.K. Dimock

Dec. 1957.

CHECKED BY

DATE

AIRCRAFT:

ARROW

UNCLASSIFIED / NON CLASSIFIÉ

TABLE 7

TIME TO DROP DATA

| <u>RUN NO.</u> | <u>ALT.</u> | <u>M</u> | <u>α°</u> | <u>FILM SPEED FRAMES/SEC.</u> | <u>SEC./FRAME FULL SCALE</u> | <u>FRAMES TO DROP</u> | <u>TIME TO DROP SEC. FULL SCALE</u> |
|----------------|-------------|----------|-----------|-----------------------------------|----------------------------------|---------------------------|---|
|----------------|-------------|----------|-----------|-----------------------------------|----------------------------------|---------------------------|---|

TANK FULL

| | | | | | | | | |
|----|-------|----|------|-----|-----|--------|-----|-----|
| 30 | S.L. | .2 | 12.8 | 0 | 720 | .00525 | 109 | .57 |
| 9 | 20000 | .5 | 5.4 | 0 | 780 | .00485 | 111 | .54 |
| 11 | 40000 | .5 | 13.7 | 0 | 720 | .00525 | 124 | .65 |
| 20 | 40000 | .5 | 13.7 | -5° | 780 | .00425 | 118 | .57 |

TANK EMPTY

| | | | | | | | | |
|----|-------|----|------|-----|-----|--------|-----|-----|
| 13 | S.L. | .5 | 2.3 | -5° | 750 | .00504 | 42 | .21 |
| 3 | 20000 | .5 | 5.4 | 0 | 720 | .00525 | 67 | .35 |
| 5 | 40000 | .5 | 13.7 | 0 | 760 | .0050 | 106 | .53 |

Time to drop = Time for top of tank forward pylons
to drop 6 ft. below the aircraft fuselage.

3010-105-1

| FIN GEOMETRY | | AFT PYLON | | GUIDE PIN HEIGHT |
|--------------|-------|----------------|------|---------------------------|
| SMALL | LARGE | TANK INCIDENCE | | 5° DROP ANGLE |
| A | 4.82 | -2° | -3° | .051 |
| B | 1.21 | A | .493 | 7 1/2° DROP ANGLE .065 |
| C | 1.40 | B | .504 | |

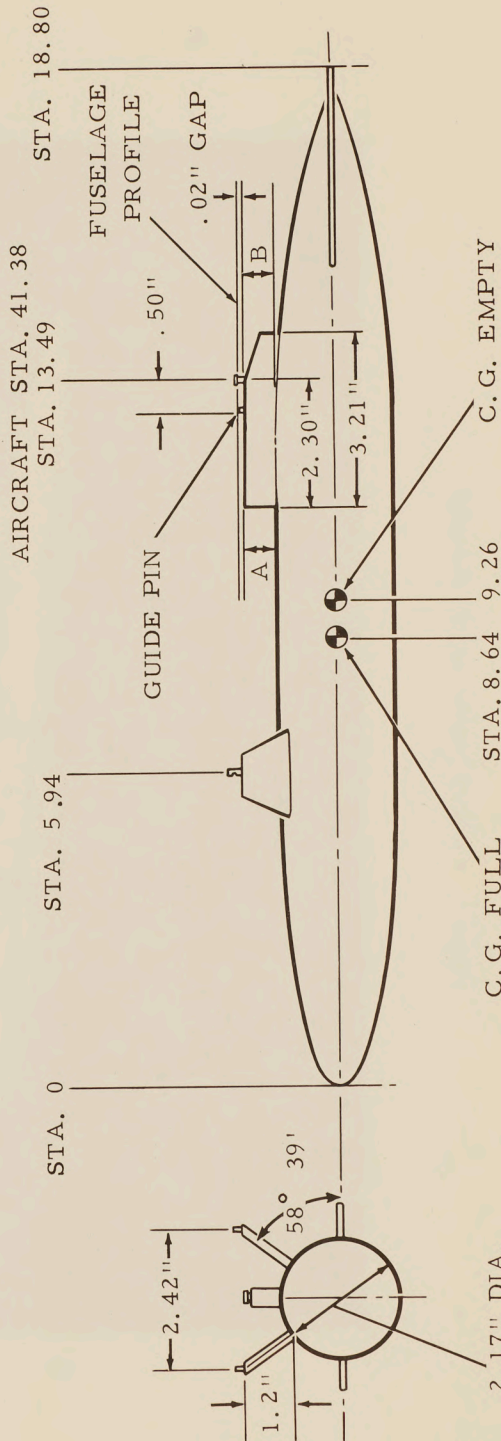
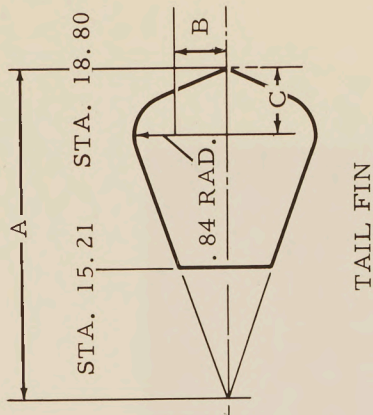


FIG. 1 .07 SCALE LONG RANGE TANK GEOMETRY

CONFIDENTIAL
P/WIND TUNNEL/138
UNCLASSIFIED / NON CLASSIFIÉ

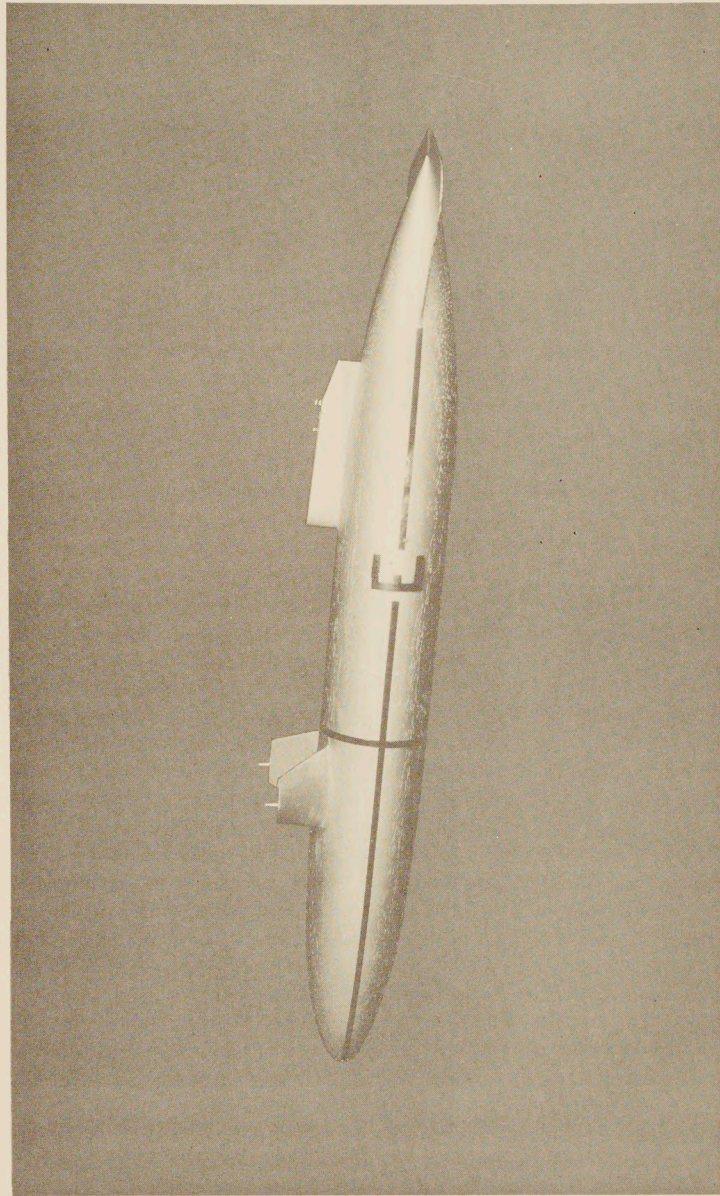


FIG. 2 LONG RANGE TANK MODEL

UNCLASSIFIED / NON CLASSIFIÉ

UNCLASSIFIED / NON CLASSIFIÉ



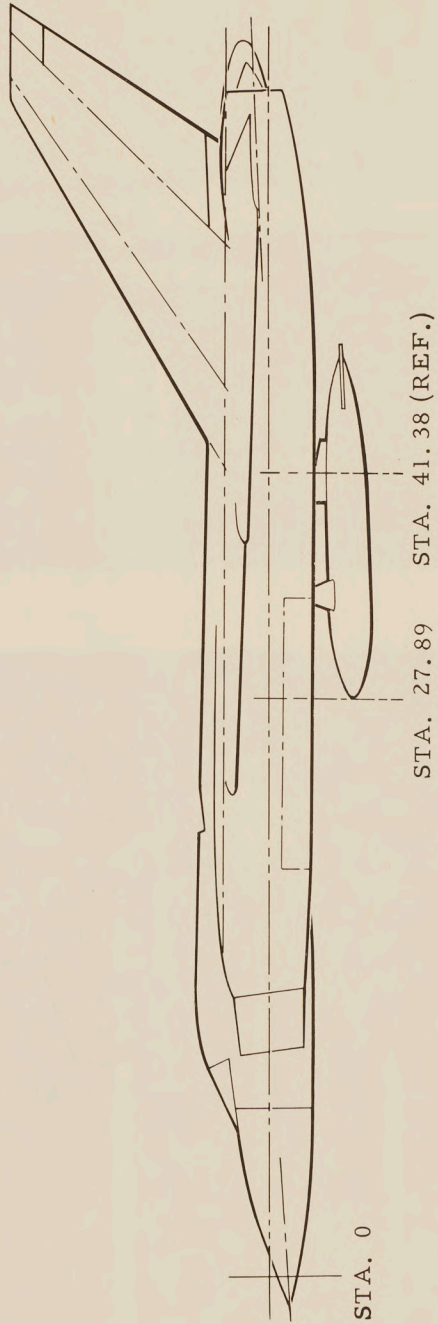


FIG. 3 ARROW .07 SCALE LONG RANGE TANK INSTALLATION

UNCLASSIFIED / NON CLASSIFIÉ

UNCLASSIFIED / NON CLASSIFIE

3011-105-1

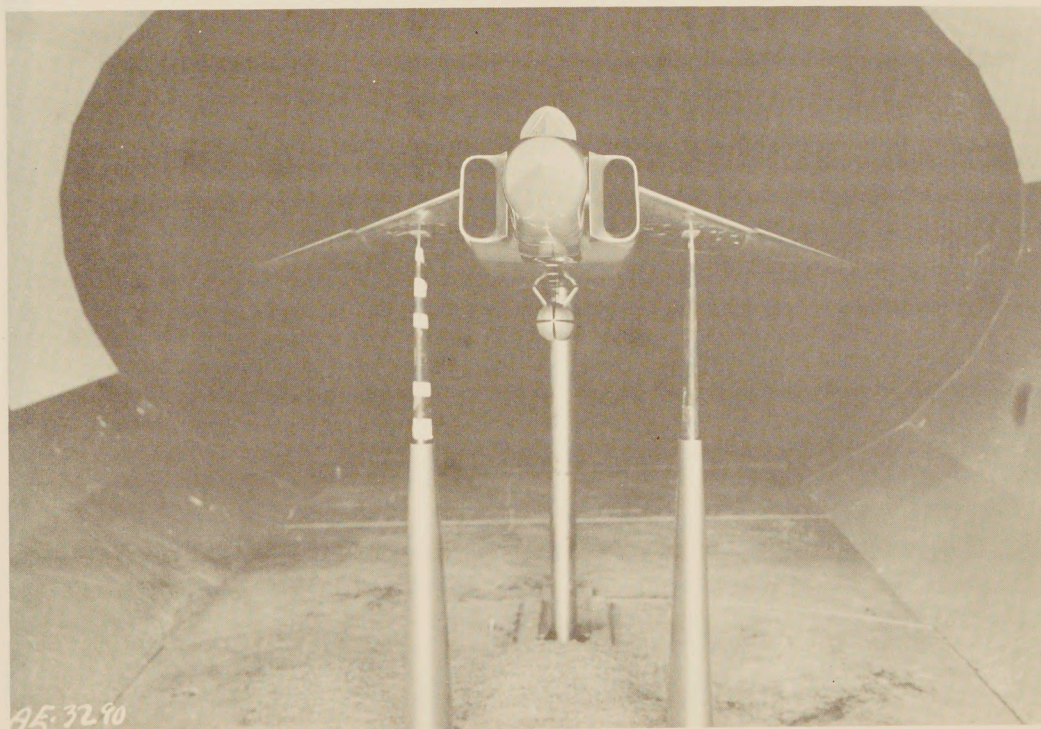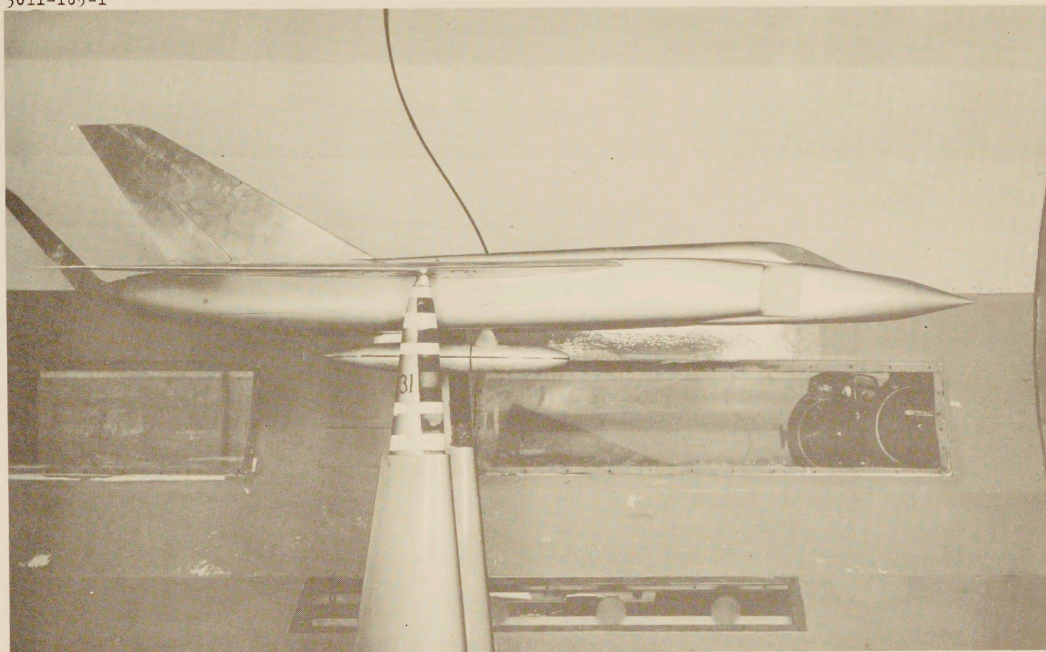

9E.3290

FIG. 4 JETTISON TEST ARRANGEMENT IN
THE 6' X 10' LOW SPEED WIND TUNNEL

UNCLASSIFIED / NON CLASSIFIE

FULL SCALE TIME
IN SECONDS



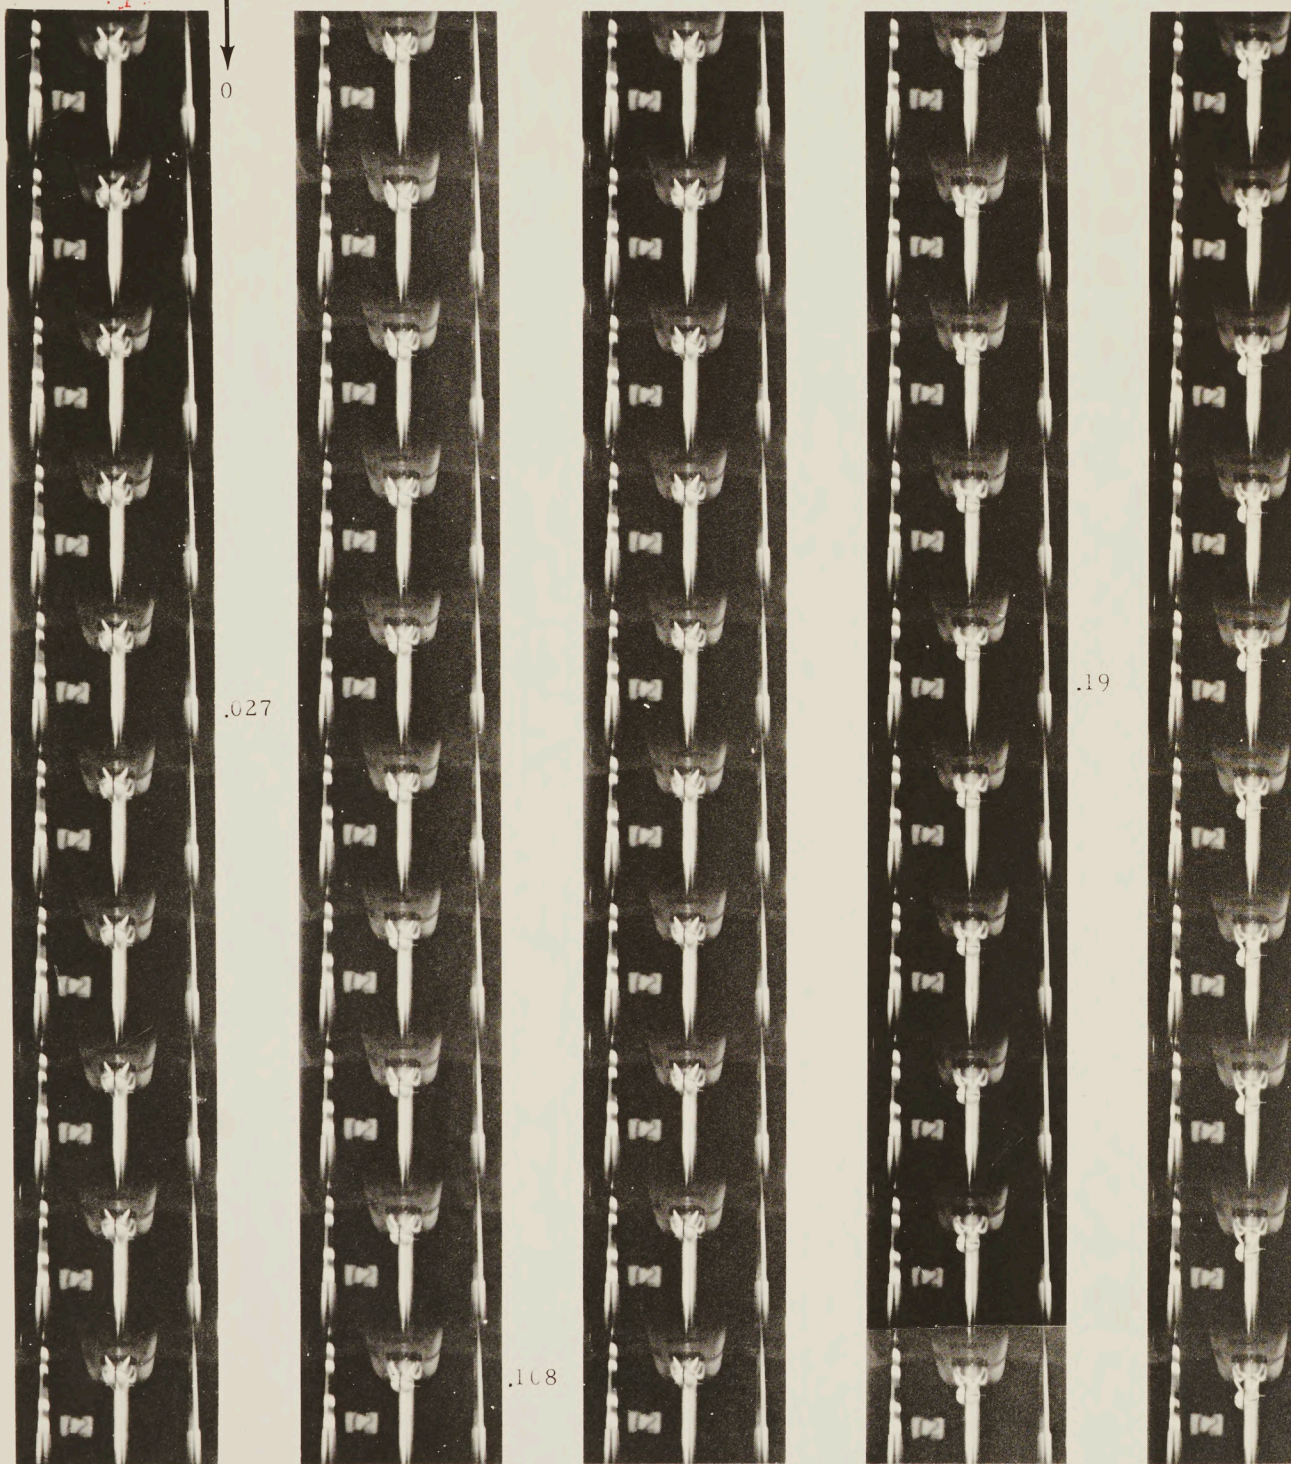




FIG. 5 (a) FRONT VIEW RUN NO. 12 - 40,000 FT., $M = .85$, $\alpha = 4.4^\circ$
TANK FULL, $\psi = 0$
FILM SPEED 700 FRAMES PER SECOND.

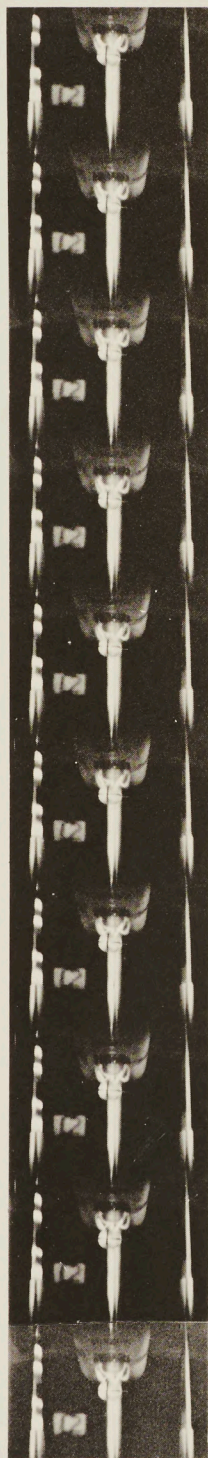


.19

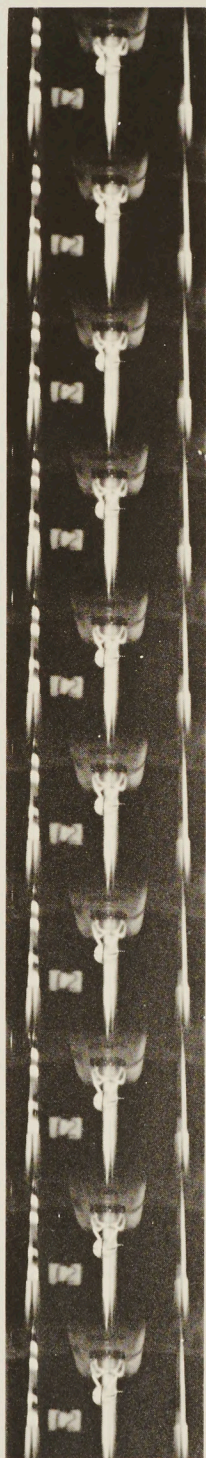

.27

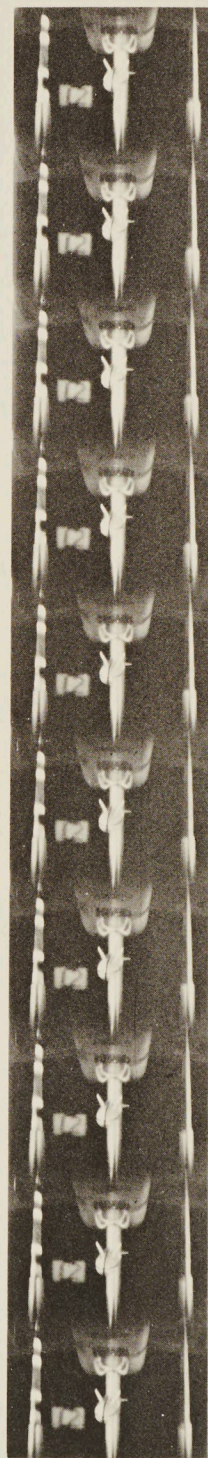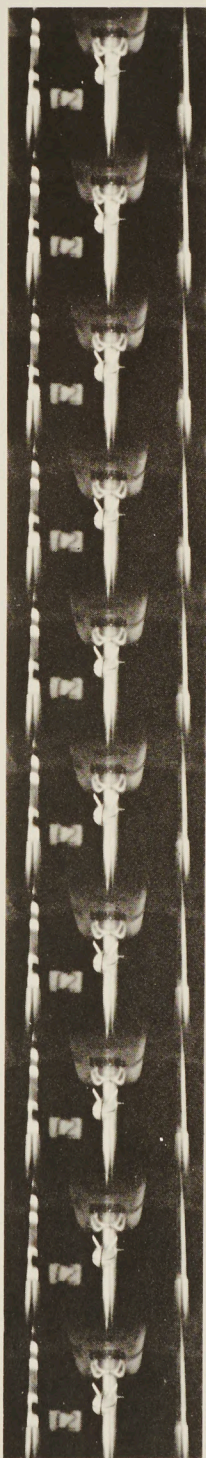

.35

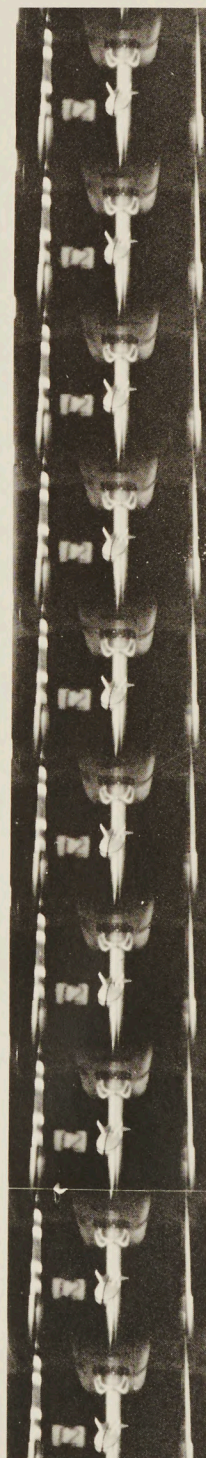

.43


.85, $\alpha = 4.4^\circ$

FULL SCALE TIME
IN SECONDS




FIG. 5 (b) SIDE VIEW RUN NO. 12 - 40,000 FT., $M = .85$, $\alpha = 4.4^\circ$
TANK FULL, $\psi = 0$
FILM SPEED 750 FRAMES PER SECOND.


UNCLASSIFIED FROM 12/1/85

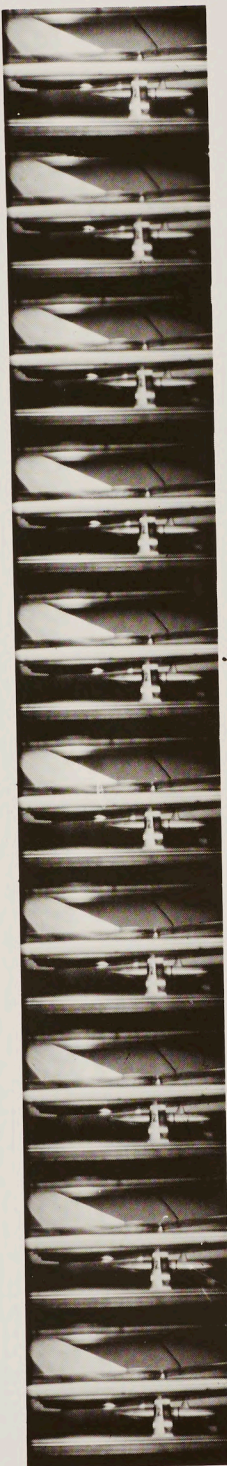


.175

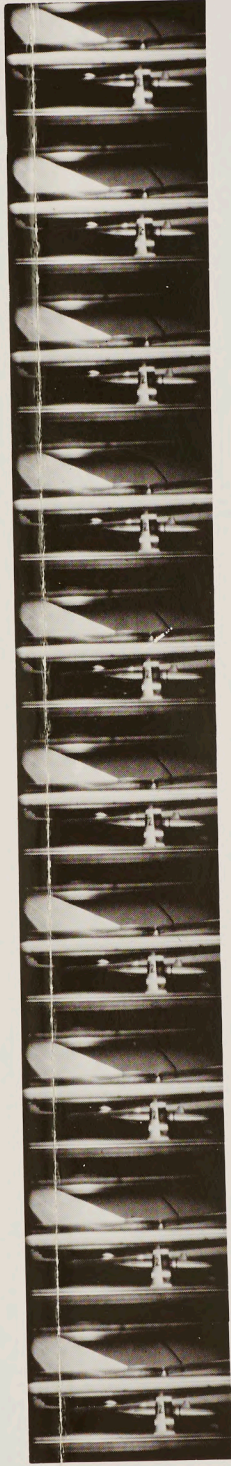

.25

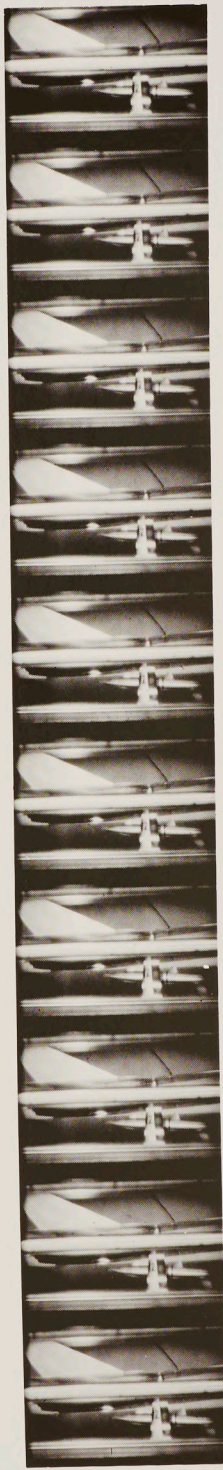

.33

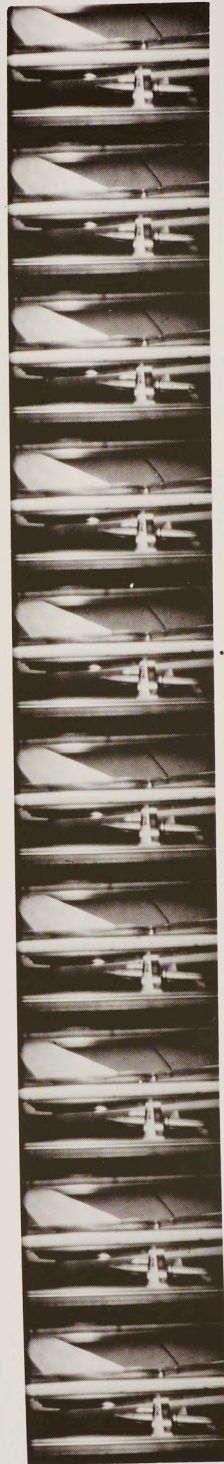

.40

85, $\alpha = 4.4^\circ$

UNCLASSIFIED FROM 12/1/85

FULL SCALE TIME
IN SECONDS

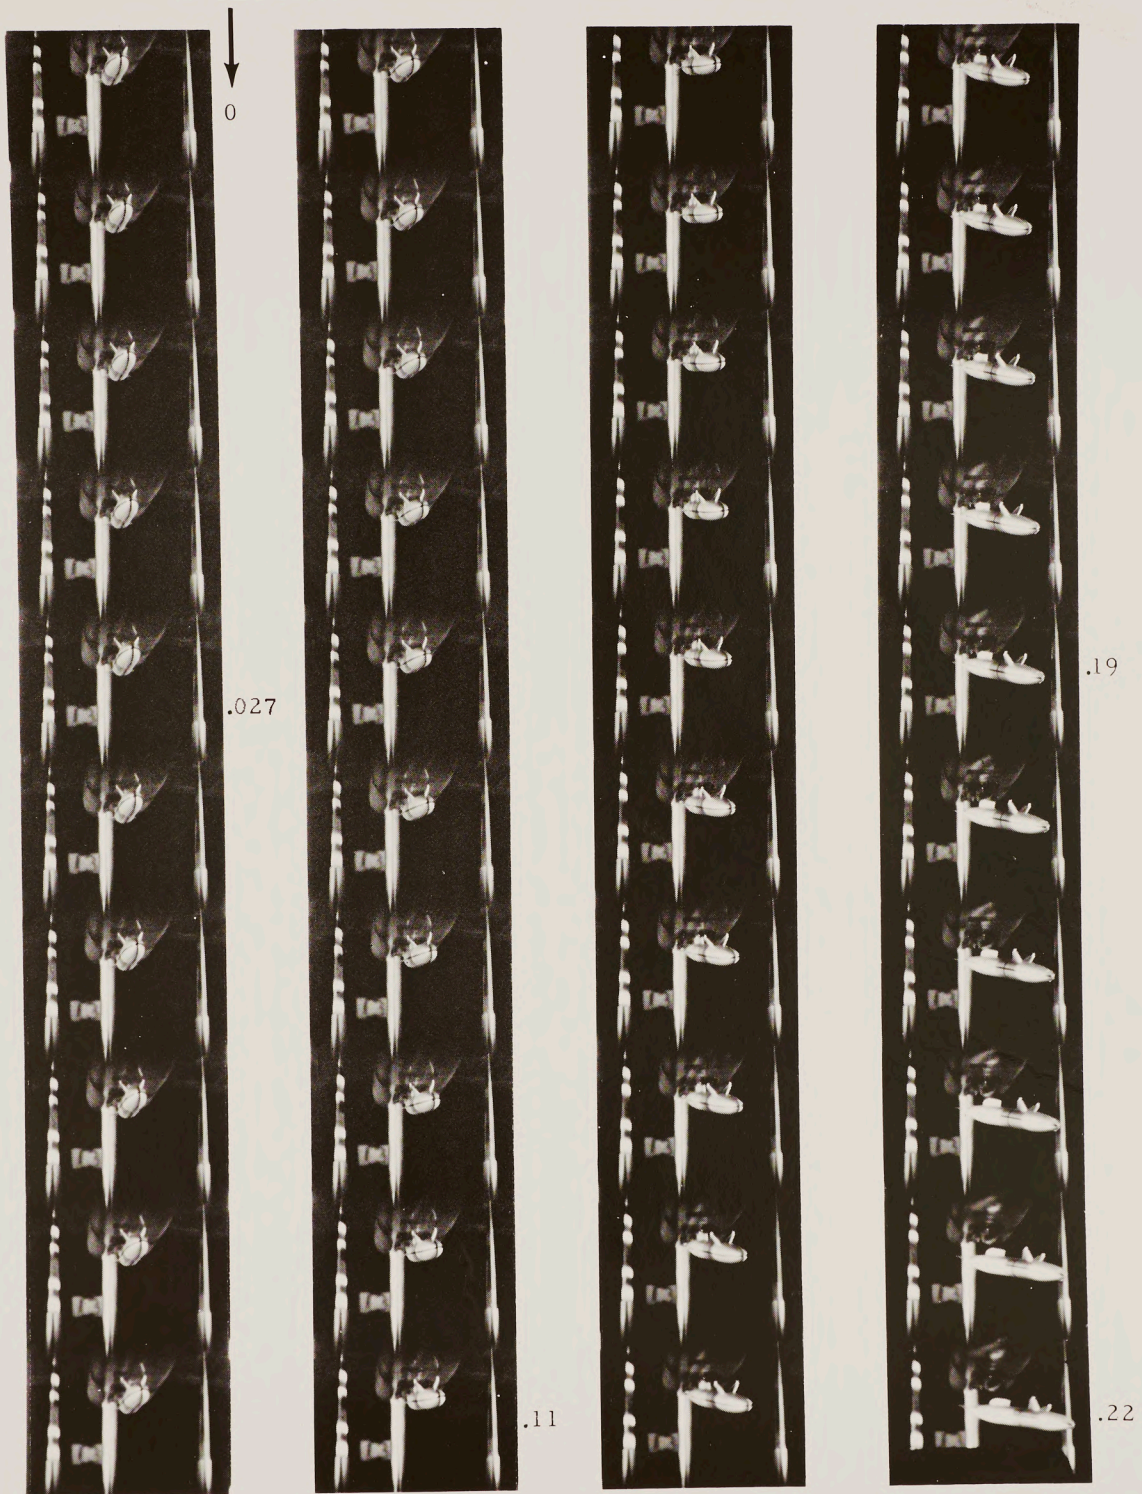


FIG. 6 (a) FRONT VIEW RUN NO. 13 - SEA LEVEL, $M = .50$, $\mathcal{L} = 2.3^\circ$
TANK EMPTY, $\psi = -5^\circ$
FILM SPEED 696 FRAMES PER SECOND.

UNCLASSIFIED - NON CLASSIFIE



FULL SCALE TIME
IN SECONDS




FIG. 6 (b) SIDE VIEW RUN NO. 13 - SEA LEVEL, M =
TANK EMPTY, $\psi = -5^\circ$
FILM SPEED 750 FRAMES PER SECOND.

UNCLASSIFIED FOR DISSEM

UNCLASSIFIED / NON CLASSIFIÉ

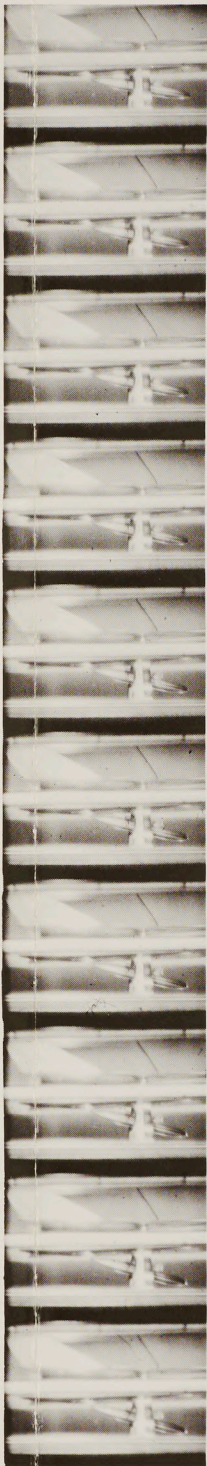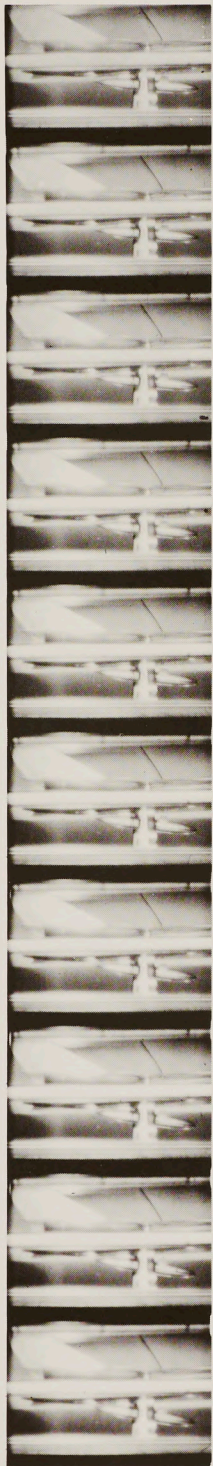

.18

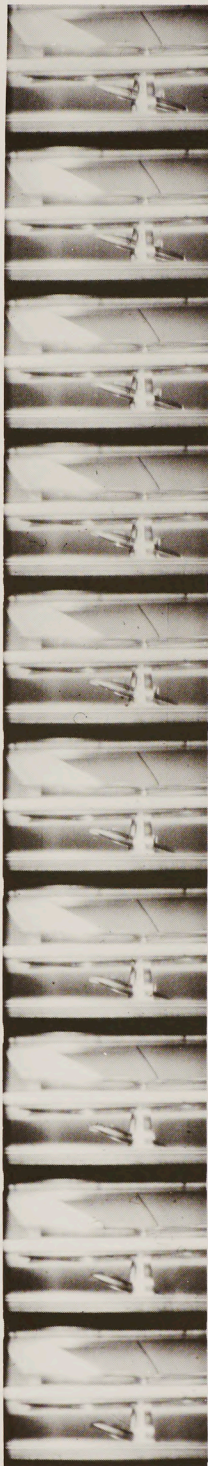

.25

UN NO. 13 - SEA LEVEL, $M = .50$, $\alpha = 2.3^\circ$
 $\psi = -5^\circ$
750 FRAMES PER SECOND.

UNCLASSIFIED / NON CLASSIFIÉ

UNCLASSIFIED / NON CLASSIFIED

THE TANG
1933
MADE IN U.S.A.